


# Soft-Seal

## Tube To O-Ring Boss

### S-GRT: Straight Thread Run Tee

Connects fractional tube to female SAE/MS straight thread

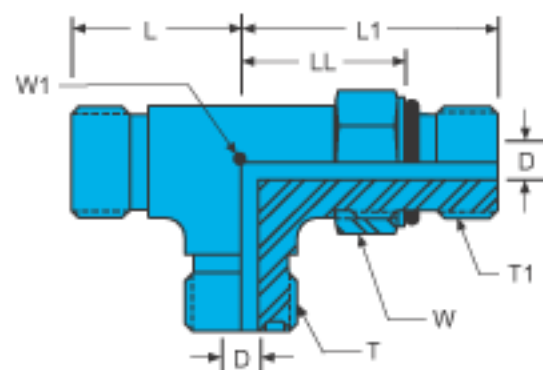

\* Working Pressures

Part Number	Tube O.D.	T Thread	T1 Thread	D Through Hole	D1 Through Hole	L	L1	LL After Inst.	W Hex	W1 Wrench Flat	Stainless Steel*	Monel*	Brass*
S4GRT	1/4	9/16 - 18	7/16 - 20	0.172	0.172	0.85	1.29	0.86	5/8	9/16	6000	---	---
S6GRT	3/8	11/16 - 16	9/16 - 18	0.264	0.264	0.98	1.45	0.98	3/4	3/4	6000	---	---
S8GRT	1/2	13/16 - 16	3/4 - 16	0.378	0.378	1.10	1.60	1.06	15/16	3/4	6000	---	---
S10GRT	5/8	1 - 14	7/8 - 14	0.484	0.484	1.31	1.97	1.34	1-1/16	1-1/16	6000	---	---
S12GRT	3/4	1-3/16 - 12	1-1/16 - 12	0.609	0.609	1.47	2.17	1.44	1-3/8	1-3/16	6000	---	---
S16GRT	1	1-7/8 - 12	1-5/16 - 12	0.812	0.812	1.64	2.35	1.62	1-5/8	1-7/16	5500	---	---
S20GRT	1-1/4	1-11/16 - 12	1-5/8 - 12	1.024	1.024	1.76	2.45	1.72	1-7/8	1-5/8	4000	---	---
S24GRT	1-1/2	2 - 12	1-7/8 - 12	1.260	1.260	1.92	2.59	1.86	2-1/8	1-7/8	4000	---	---