


# Threaded Adapter

## Nipple

HN: Hex Nipple

Connects female NPT thread

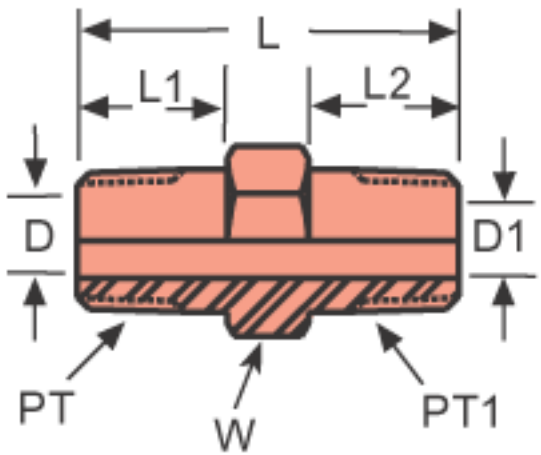

\* Working Pressures

Part Number	PT Pipe Thread	PT1 Pipe Thread	D Through Hole	D1 Through Hole	L	L1	L2	W Hex	Stainless Steel*	Monel*	Brass*
1/8HN	1/8 - 27	1/8 - 27	0.19	0.19	1.06	0.38	0.38	7/16	10050	---	5050
1/4HN	1/4 - 18	1/4 - 18	0.28	0.19	1.45	0.56	0.56	5/8	8050	---	4050
1/4X1/8HN	1/4 - 18	1/8 - 27	0.28	0.19	1.26	0.56	0.38	5/8	8050	---	4050
3/8HN	3/8 - 18	3/8 - 18	0.41	0.41	1.45	0.56	0.56	3/4	7850	---	3950
3/8X1/4HN	3/8 - 18	1/4 - 18	0.41	0.28	1.45	0.56	0.56	3/4	7850	---	3950
1/2HN	1/2 - 14	1/2 - 14	0.53	0.53	1.89	0.75	0.75	7/8	7750	---	3850
1/2X1/4HN	1/2 - 14	1/4 - 18	0.53	0.28	1.70	0.75	0.56	7/8	7750	---	3850
1/2X3/8HN	1/2 - 14	3/8 - 18	0.53	0.41	1.70	0.75	0.56	7/8	7750	---	3850
3/4HN	3/4 - 14	3/4 - 14	0.72	0.28	1.96	0.75	0.75	1-1/8	7350	---	3650
3/4X1/4HN	3/4 - 14	1/4 - 18	0.72	0.28	1.78	0.75	0.56	1-1/8	7350	---	3650
3/4X3/8HN	3/4 - 14	3/8 - 18	0.72	0.41	1.77	0.75	0.56	1-1/8	7350	---	3650
3/4X1/2HN	3/4 - 14	1/2 - 14	0.72	0.53	1.96	0.75	0.75	1-1/8	7350	---	3650
1HN	1 - 11-1/2	1 - 11-1/2	0.94	0.94	2.34	0.94	0.94	1-3/8	5350	---	2650
1X3/4HN	1 - 11-1/2	3/4 - 14	0.94	0.72	2.15	0.94	0.75	1-3/8	5350	---	2650
1X1/2HN	1 - 11-1/2	1/2 - 14	0.94	0.53	2.15	0.94	0.75	1-3/8	5350	---	2650
1-1/4HN	1-1/4 - 11-1/2	1-1/4 - 11-1/2	1.25	1.25	2.48	0.97	0.97	1-3/4	3400	---	---
1-1/2HN	1-1/2 - 11-1/2	1-1/2 - 11-1/2	1.50	1.50	2.61	1.00	1.00	2	2800	---	---
2HN	2 - 11-1/2	2 - 11-1/2	1.94	1.94	2.82	1.03	1.03	2-1/2	2450	---	---